

SAILOR

Service Information No.
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.

50

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato September 1973

Service information T122

In some cases there have been problems with HF influx via the handset, which had the effect that the aerial current does not fall to zero in position SSB, when the modulation stops. The problem is only connected with installations with a long earth connection, and it can be solved in connecting a capacitor (inside the transmitter) from pin 5 on the handset plug J8o2 and to frame.

This amendment has been adopted in the production from set no. 98656.

If the problem is grave, it will help to connect 2 prs. 0,1 uF capacitors to earth terminal from plus and minus 24V on the termin strip inside the cabinet.



Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

A/S S. P. RADIO
Aalborg - Denmark