

SAILOR

Service Information No. 53
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.


Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato October 1973

From serial no. 102070 and onward the transmitter T122 will be produced with a somewhat modified aerial output in order to eliminate the risk of flash over.


The modification will be comprising:

A) Larger distance between contacts in the drum change-over switch and consequently introduction of a new type of contact screws (the small yellow plastic screws that are delivered along with each transmitter).

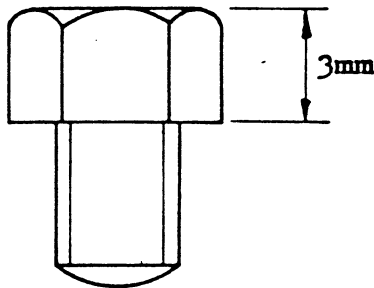

Old type

is only to be used in transmitters with a serial no. lower than 102070.

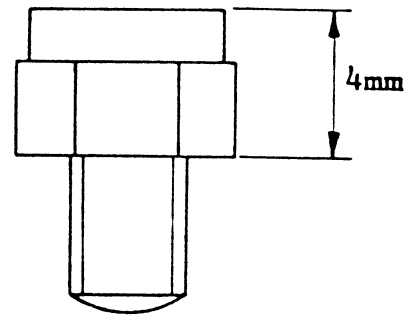

New type

is only to be used in transmitters with a serial no. from 102070 and onwards.

B) Modified diagram and consequently amendment of the tuning procedure for the aerial tuning specified in Section B VIII of the instruction manual.

This will of course involve an amendment of the instruction manual for transmitters with a serial no. from 102070 and onward.

To avoid misunderstandings the instruction manuals related to transmitter with a serial no. from 102070 and onward, will on the front page carry a notice to this effect.

Likewise, during the transitional period, all transmitters will carry a label, on which will be clearly stated, which of the instruction manual you must use for the tuning of the transmitter in question.

Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

1/5 S. P. RADI
Aalborg - Denma

