

# SAILOR

Service Information No.  
 Kundendienst-Mitteilung No.  
 Service Information No. 61  
 Información de servicio No.  
 Servicemeddelelse No.

Series / Serie / Numéro de série / Serie / Serie


Date / Datum / Date / Fecha / Dato February 1975

Supplement to point 7, Chapter C IV, Adjustment of AERIAL TUNE, LOAD and INTERNAL DRIVE in the instructionbook for T124.

If it is not possible to bring the meter close to the zero line, like described under point 7 (the pointer of the meter is to the right of the zero line, even with contact 31 activated), this can be remedied by moving all coupling steps, 2 steps down, by soldering as shown below.

Capacitor before soldering.

Capacitor after soldering.

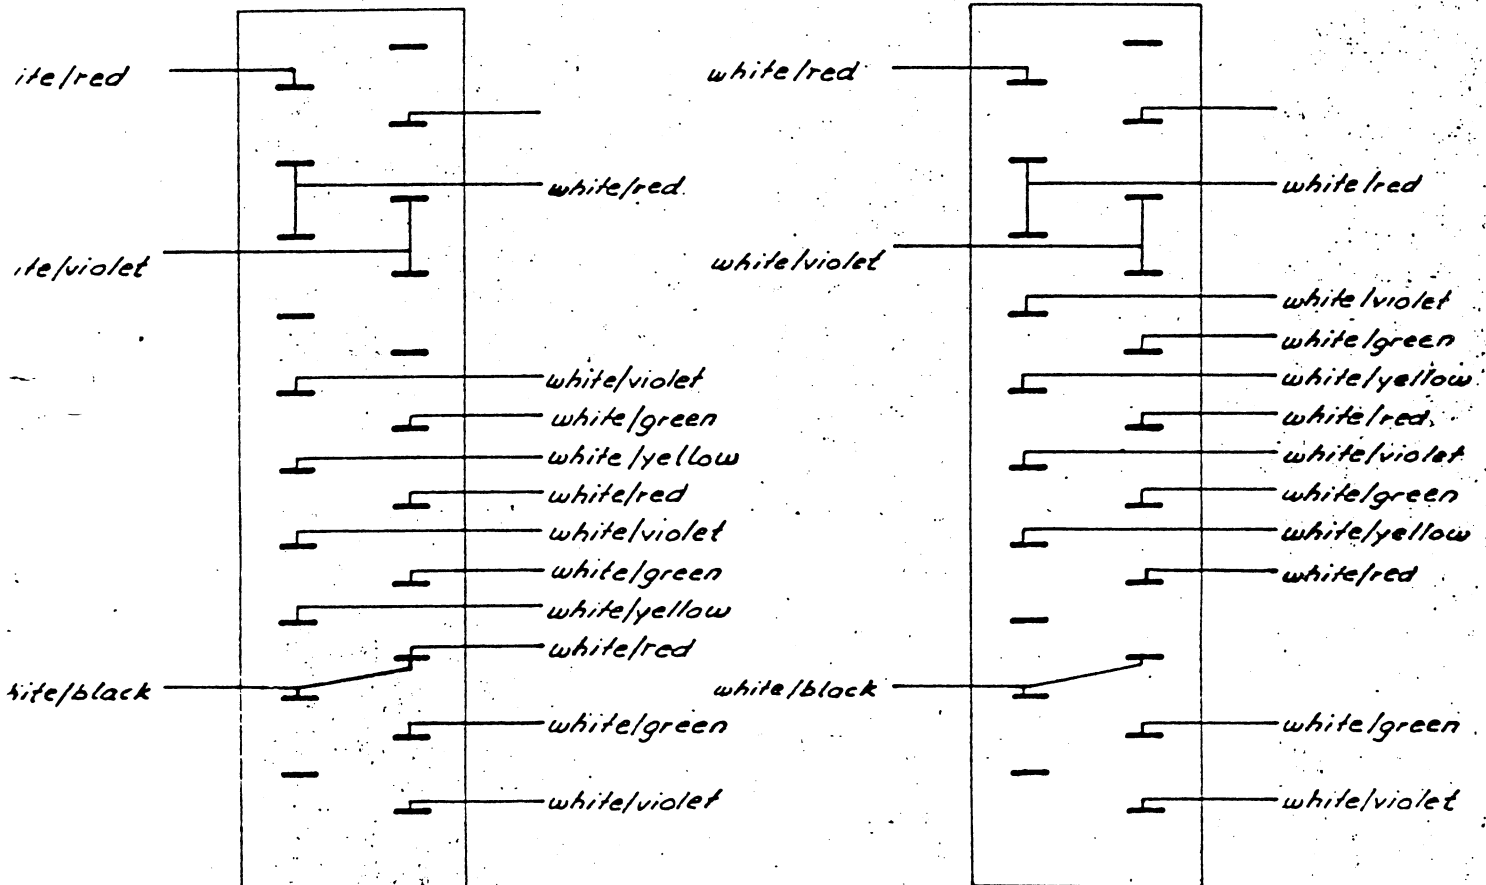

Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.



S. P. RADIO  
 Aalborg - Denmark