

SAILOR

Service Information No. 76
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato April, 1981

Modification in RT144C owing to heavy diffusion in the output response from MC4044, phase/frequency-detector.

The modification has been made from series No.: 217850.

Divider-unit:	Component	from	to
	R630	1 Kohm	2.2 Kohm
	R631	1 Kohm	2.2 Kohm
TX-Exciter:	R935	1 Kohm	1.5 Kohm

At future repairs, at which one of the two above mentioned modules is to be replaced, allowance must be made for the above mentioned modification. A modified Divider-unit must not be used together with a TX-Exciter, which is not modified, and vice versa.

The modification will result in an increase of the transient time at channel switching by about 10 ms switching from Simplex to Duplex channels.

In order to make sure that the Dual Watch will catch on channel 16, R1113 in the Dual-Watch-unit must be modified from 18 Kohm to 22 Kohm.



Please file this information in the service-portfolio we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

.....

A/S S. P. RADIO

Aalborg - Denmark

.....