

SAILOR

Service Information No. 96
Kundendienst-Mitteilung No.
Service Information No.
Información de servicio No.
Servicemeddelelse No.

Series / Serie / Numéro de série / Serie / Serie

Date / Datum / Date / Fecha / Dato August, 1985

T1130 SERIAL NO. FROM 294215 TO 294290

We have experienced that a pull-up resistor R502 is missing on the tune control unit module 500.

This means that the prom's IC501 and IC503 are more sensitive to noise. This means that the transmitter might go into dummy load position during a normal transmission.

If you get problems as described above please mount R502 10 kohm located between IC503 and IC509, see the instuction book for T1130.

August 1985

T1130 SERIENUMMER FRA 294215 TIL 294290

Vi har erfaret, at der mangler en pull-up modstand R502 på tuner control modulet 500.

Det betyder, at de to prommer IC501 og IC503 bliver mere støjfølsomme. Dette medfører, at senderen pludselig under normal drift kan gå i dummy load position.

Hvis De får et problem som ovenfor beskrevet, så monter venligst R502 10 kohm placeret mellem IC501 og IC503, se instruktionsbogen for T1130.



Please file this information in the service-portfolie we have sent you.

Bitte archivieren Sie diese Mitteilung in der Kundendienstmappe, die wir Ihnen gesandt haben.

Nous vous prions de bien vouloir classer ce document dans le dossier bleu qui vous a été envoyé à cet effet.

Sivanse archivar esta información en la cubierta de servicio que les hemos enviado a Ustedes.

De bedes venligst arkivere denne meddelelse i den tilsendte servicemappe.

S. P. RADIO

Aalborg - Denmark